


**Alignment report**  
 Laser alignment system AVV-701  
 No. 0906150065



Company	Marine Services
Site	Eastern Anchorage - Vessel MT
Machine	Diesel Engine
Remark	Laser bore centerline inspection
Filename	Vessel MT/Eastern Anchorage/EngineRoom/Diesel Engine (0521_164134 - Alignment - Half circle)
Date:	21.05.2010 16:41:34
Unit:	
S Unit:	No. 0000000000
M Unit:	No. 0701180169
Program:	BoreCenterline

Total length	2350.000			
Number of intervals	6			
Fixed position 1	0.000			
Fixed position 2	2350.000			
Tolerance	0.800			
Num	Fixed Ref	Dist	Y data	X data
1	Fixed ref. 1	0	0.000	0.000
2		385	0.005	0.012
3		770	-0.003	-0.003
4		1175	0.016	0.028
5		1580	0.029	-0.020
6		1965	-0.046	-0.071
7	Fixed ref. 2	2350	0.000	0.000
Min			-0.046	-0.071
Max			0.029	0.028
Avg.			0.000	-0.007
Pk-Pk			0.075	0.100

### Y data

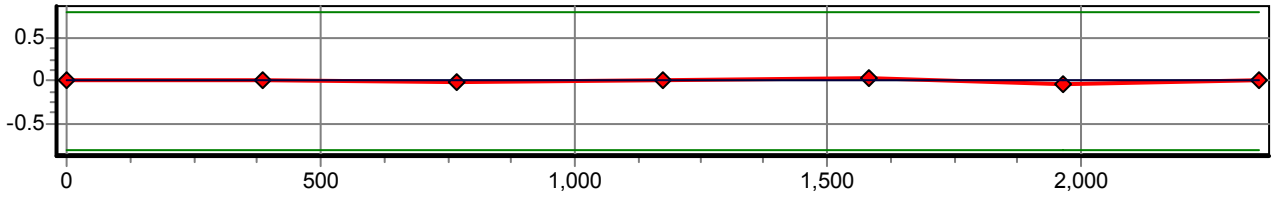

### X data

